



Driver's Seat Squeaks

(Supersedes 06-018, dated May 12, 2006, to update the information marked with the black bars)

SYMPTOM

The driver's seat squeaks when the driver moves in it.

PROBABLE CAUSE

The driver's seat bracket rubs against the floor panel.

CORRECTIVE ACTION

■ Reposition the seat or insulate the bracket from the floor panel.

WARRANTY CLAIM INFORMATION

In warranty: The normal warranty applies.

Operation Number: 851055

Flat Rate Time: 0.4 hour

Failed Part: P/N 81510-SEC-A01

Defect Code: 07403

Symptom Code: 04205


Template ID: 06-018A

Skill Level: Repair Technician

Out of warranty: Any repair performed after warranty expiration may be eligible for goodwill consideration by the District Parts and Service Manager or your Zone Office. You must request consideration, and get a decision, before starting work.

REPAIR PROCEDURE

1. Remove the seat track end covers:
 - Refer to page 20-99 in the *04-06 TSX Service Manual*, or
 - Online, enter keyword **FRONT SEAT** and select **Front Seat Removal/Installation**.
2. Loosen the four seat anchor bolts.
3. Push the seat forward against the rear anchor bolts and upward against the front anchor bolts, then tighten all four bolts.

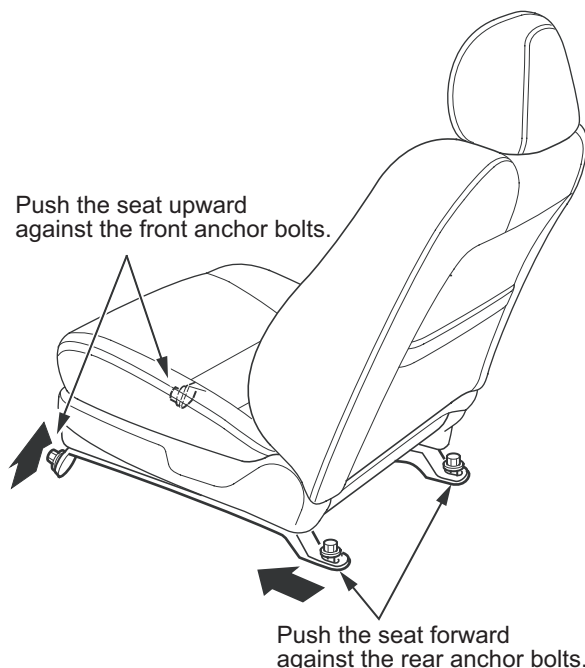


4. Sit in the driver's seat, and move around:
 - If the seat still squeaks, go to step 5.
 - If the squeak is gone, go to step 10.
5. Remove the four seat anchor bolts, and tilt the seat backward.

6. Locate the scratch marks made by the seat frame on both sides of the floor panel (right side is shown).



Locate the scratch mark made by the seat frame.

7. Cut two 15mm square pieces of carpet from underneath the driver's seat, and use weatherstrip adhesive to glue them over the marks as shown.

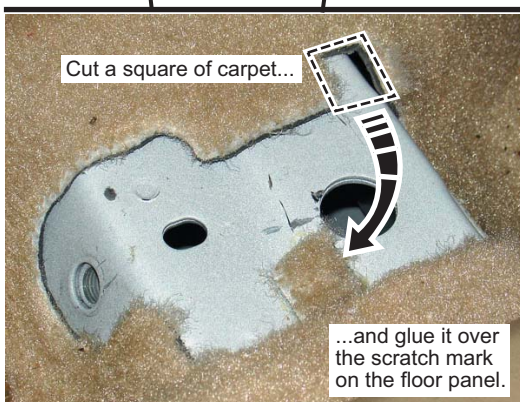

8. Install the seat in the reverse order of removal.
9. Torque the bolts to **34 N·m (25 lb-ft)**.
10. Reinstall the seat track end covers.