

Service Bulletin



Applies To: 2004–08 TSX – ALL

March 20, 2008

Front Door Glass Squeaks When Going Up or Down

SYMPTOM

The left or right front door glass squeaks when going up or down.

PROBABLE CAUSE

The glass is rubbing on its inner weatherstrip.

CORRECTIVE ACTION

Replace the door glass inner weatherstrip.

PARTS INFORMATION

Left-Front Door Glass Inner Weatherstrip: P/N 72375-SEA-013 Right-Front Door Glass Inner Weatherstrip: P/N 72335-SEA-013

TOOL INFORMATION

KTC Trim Tool Set: T/N SQJATP2014

WARRANTY CLAIM INFORMATION

In warranty: The normal warranty applies.

OP#	Description		FRT
8351A4	Replace the left-front door glass inner weatherstrip.		0.4
8361A4	Replace the right-front door glass inner weatherstrip.		0.4
Failed Part:		P/N 72335-SEA-013	
Defect Code:		03001	
Symptom Code:		04205	

Skill Level: Repair Technician

Out of warranty: Any repair performed after warranty expiration may be eligible for goodwill consideration by the District Parts and Service Manager or your Zone Office. You must request consideration, and get a decision, before starting work.

DIAGNOSIS

- 1. Lower the affected door glass two-thirds of the way down.
- 2. Slip a piece of paper or thin cardboard between the glass and the inner door panel weatherstrip.
- 3. While holding the paper in place, move the glass up and down.
 - If the squeak is gone, go to REPAIR PROCEDURE.
 - If the squeak is still there, remove the door panel and continue with normal diagnosis for run channel or regulator noise.
 - If caused by the inner weatherstrip, the squeak may go away after repeated operation of the door glass but return after several days.
 - Do not replace the regulator or the run channel unless the squeak is still there when the glass is moved up and down with the inner door panel removed.

REPAIR PROCEDURE

Remove the front door panel, and replace the door glass inner weatherstrip:

- Refer to page 20-7 of the 2004–08 TSX Service Manual, or
- Online, enter keywords DOOR PANEL, and select Front Door Panel Removal/Installation from the list.

Skill Level

© 2008 American Honda Motor Co., Inc. – All Rights Reserved

BTB 38875 (0803)

1 of 1

CLIENT INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Acura automobile dealer.