



Applies To: 2009 TSX – ALL

June 4, 2008

Beverage Holder Lid Will Not Open

SYMPTOM

The hinged lid covering the beverage holder does not open.

PROBABLE CAUSE

The center console is slightly out of alignment, causing the beverage holder lid to bind against the center console panel.

CORRECTIVE ACTION

Realign the center console to eliminate the binding.

TOOL INFORMATION

KTC Trim Tool Set: T/N SOJATP2014

WARRANTY CLAIM INFORMATION

In warranty: The normal warranty applies.

Operation Number: 8410B2

Flat Rate Time: 0.2 hour

Failed Part: 77230-TL0-G01ZA

Defect Code: 03001

Symptom Code: 07902


Template ID: 08-037A

Skill Level: Repair Technician


Out of warranty: Any repair performed after warranty expiration may be eligible for goodwill consideration by the District Parts and Service Manager or your Zone Office. You must request consideration, and get a decision, before starting work.

REPAIR PROCEDURE

1. Adjust the driver's and passenger's front seats to the forward-most position.
2. Gently pry out the center console rear trim, with the appropriate trim tool, to detach the clips and release the trim tabs.

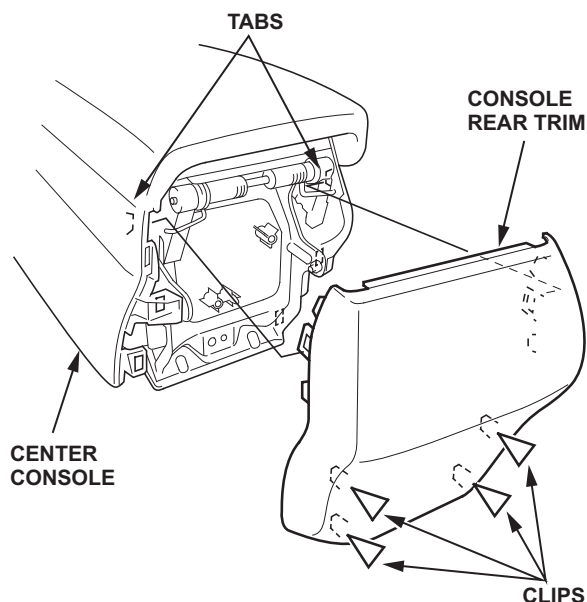

3. Loosen, but do not remove, the bolts securing the center console.

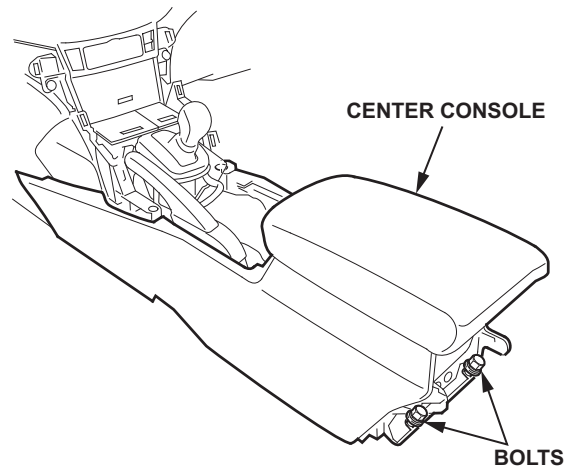

4. Pull the back of the center console toward the driver's side, and hold it in position while you tighten the bolts to 9.8 N·m (7.2 lb-ft).



5. If the beverage holder lid opens and closes normally, reinstall the center console rear trim.
6. If the beverage holder lid still binds against the center console panel, repeat steps 3 and 4, but do not tighten the bolts.
7. Continue to hold the back of the center console toward the driver's side. Have an assistant push the center console panel toward the passenger's side and hold it in position. Tighten the bolts to 9.8 N·m (7.2 lb-ft).



8. Verify that the beverage holder lid opens and closes with no binding.
9. Reinstall the center console rear trim.